

M PROPS (PTY) LTD

Risk Assessment of the Medium Duty Camlok Prop

Report No. 334822/2

Revision May 2006



M PROPS (PTY) LTD

Risk Assessment of the Medium Duty Camlok Prop

By:

J.L. Human

Reviewed By:

A Swart

Revised By:

A.S. Nortjé

Revision Reviewed By:

P. Terbrugge

Report No. 334822/2

Steffen, Robertson and Kirsten (South Africa) (Pty) Ltd
265 Oxford Road
Illovo
2196
South Africa

Registration Number: 1995.012890.07

Revision May 2006

P O Box 55291
Northlands
2116
South Africa
Tel: (011) 441-1111
Fax: (011) 880-8086

Contents

| | | |
|--------|---|----|
| 1 | Introduction | 1 |
| 2 | Risk Assessment Team | 2 |
| 3 | Quality Assurance..... | 3 |
| 4 | Risk Assessment Process | 3 |
| 4.1 | Medium Duty Camlok Prop Life Cycle..... | 4 |
| 4.1.1 | Procurement Procedure..... | 4 |
| 4.1.2 | Receiving by Mine..... | 5 |
| 4.1.3 | Surface Storage | 5 |
| 4.1.4 | Dispatching to the Shaft..... | 6 |
| 4.1.5 | Shaft Transport | 6 |
| 4.1.6 | Horizontal Transport..... | 7 |
| 4.1.7 | Transport in the Workplace | 7 |
| 4.1.8 | Installation | 8 |
| 4.1.9 | Installed Prop..... | 9 |
| 4.1.10 | Prop Removal | 11 |
| 4.1.11 | Underground Storage..... | 11 |
| 4.1.12 | Daily Underground Prop Assessment..... | 12 |
| 4.1.13 | Removal of ‘not fit for purpose’ Props..... | 12 |
| 4.2 | Risk Profile | 13 |
| 5 | Conclusions | 14 |

Figures

| | |
|--|----|
| Figure 1: Life Cycle of the Medium Duty Camlok Prop..... | 4 |
| Figure 2: Risk profile of the Medium Duty Camlok Prop..... | 13 |

Tables

| | |
|--|---|
| Table 1: Risk Assessment Team Members..... | 3 |
|--|---|

Appendices

Appendix A : General Description of the Risk Assessment Method

Appendix B : Detailed Risk Assessment

Risk Assessment of the Medium Duty Camlok Prop – Revision 2006

1 Introduction

This risk assessment report is a revision of the report compiled in December 2004. M Props (Pty) Ltd requested this revision to the risk assessment due to upgrades made to the original Medium Duty Camlok Prop. This report complies with the requirements of the Mine Health and Safety Act, 29 of 1996, with specific reference to Chapter 2, Section 21.

The Medium Duty Camlok Prop referred to in this report is covered by the following patents:

95/04893

2002/08901

2005/09548

The Medium Duty Camlok Prop is designed to perform in general mining conditions, excluding seismic and high closure conditions.

The objective of the risk assessment is to logically describe the use of the Medium Duty Camlok Prop in a systematic method in order to identify the hazards and their associated probability of occurrence so that the level of risk can be assigned to the hazards. By adopting this approach, it is hoped that reading of the document would not be onerous on the reader and the major hazards and their associated risks be clearly highlighted in the text with the full risk assessment as backup in the



Partners MJ Braune, JM Brown, AC Burger, FM Cessford, JAC Cowan, CD Dalgliesh, M Harley, T Hart, NM Holdcroft, PR Labrum, RRW McNeill, HAC Meintjes, BJ Middleton, MJ Morris, GP Murray, VS Reddy, PN Rosewarne, PE Schmidt, PJ Shepherd, AA Smithen, OKH Steffen, PJ Terbrugge, KM Uderstadt, D van Bladeren, DJ Venter, HG Waldeck, A Wood

Directors AJ Barrett, PR Labrum, BJ Middleton, E Molobi, PE Schmidt, PJ Terbrugge, MB Zungu

Associates JCJ Boshoff, SA McDonald, DM Duthe, LGA Maclear, GP Nel, JP Odendaal, D Visser, AC White, AC Woodford

Consultants IS Cameron-Clarke, *PrSci Nat, MSc*; JH de Beer, *PrSci Nat, MSc*; GA Jones, *PrEng, PhD*; WD Ortlepp, *PrEng, Meng*; K Owen, *MSc Eng, DIC*; RP Plasket, *PrEng, MSc*; TR Stacey, *PrEng, DSc*; RJ Stuart, *PrTech Eng, GDE*; DW Warwick, *PrSci Nat, BSc (Hons)*

Corporate Shareholder: Kagiso Enterprises (Pty) Ltd



SRK Consulting (South Africa) (Pty) Ltd

Reg No 1995.012890.07

Cape Town +27 (0) 21 409 2400

Durban +27 (0) 31 312 1355

East London +27 (0) 43 748 6292

Harare +263 (4) 496 182

Johannesburg +27 (0) 11 441 1111

Pietermaritzburg +27 (0) 33 345 6311

Port Elizabeth +27 (0) 41 581 1911

Pretoria +27 (0) 12 361 9821

Rustenburg +27 (0) 14 594 1280

appendices. For this purpose the fault-event tree risk assessment method was selected as the most appropriate for this purpose. A brief description of the method can be found in Appendix A.

2 Risk Assessment Team

A team approach was adopted to ensure that the risk assessment covered as many aspects as possible through two workshops held in 2004, by combining the team's experience and expertise of the Medium Duty Camlok Prop. The 2006 revision was carried out by the same team from M Props, but Stéfan Nortjé represented SRK Consulting in the place of Louie Human who formed part of the original assessment team. The revision risk assessment team members are listed in Table 1.



Partners MJ Braune, JM Brown, AC Burger, FM Cessford, JAC Cowan, CD Dalgliesh, M Harley, T Hart, NM Holdcroft, PR Labrum, RRW McNeill, HAC Meintjes, BJ Middleton, MJ Morris, GP Murray, VS Reddy, PN Rosewarne, PE Schmidt, PJ Shepherd, AA Smithen, OKH Steffen, PJ Terbrugge, KM Uderstadt, D van Bladeren, DJ Venter, HG Waldeck, A Wood

Directors AJ Barrett, PR Labrum, BJ Middleton, E Molobi, PE Schmidt, PJ Terbrugge, MB Zungu

Associates JCJ Boshoff, SA McDonald, DM Duthe, LGA Maclear, GP Nel, JP Odendaal, D Visser, AC White, AC Woodford

Consultants IS Cameron-Clarke, *PrSci Nat, MSc*; JH de Beer, *PrSci Nat, MSc*; GA Jones, *PrEng, PhD*; WD Ortlepp, *PrEng, Meng*; K Owen, *MSc Eng, DIC*; RP Plasket, *PrEng, MSc*; TR Stacey, *PrEng, DSc*; RJ Stuart, *PrTech Eng, GDE*; DW Warwick, *PrSci Nat, BSc (Hons)*

Corporate Shareholder: Kagiso Enterprises (Pty) Ltd



SRK Consulting (South Africa) (Pty) Ltd

Reg No 1995.012890.07

Cape Town +27 (0) 21 409 2400

Durban +27 (0) 31 312 1355

East London +27 (0) 43 748 6292

Harare +263 (4) 496 182

Johannesburg +27 (0) 11 441 1111

Pietermaritzburg +27 (0) 33 345 6311

Port Elizabeth +27 (0) 41 581 1911

Pretoria +27 (0) 12 361 9821

Rustenburg +27 (0) 14 594 1280

Table 1: Risk Assessment Team Members

| Name | Designation | Experience |
|-------------------|---|--|
| Mr Ed Groves | Director M Props | 31 Years Research and Development & Sales. |
| Mr Colin May | Sales Manager M Props | 25 Years Research and Development & Sales |
| Mr Peter Flood | Area Sales Manager M Props | 13 Years Mining 10 Years Sales |
| Mr John von Ruben | Technical Representative Training M Props | 21 Years Mining 6 Years Training |
| Mr Mike Strong | Technical Representative Training M Props | 4 Years Mining 6 Years Training |
| Mr Stéfan Nortjé | Civil Engineer SRK Consulting | 3 Years Construction Management 2 Years Buildings Structural Design |

3 Quality Assurance

The consistency of the performance of the Medium Duty Camlok Prop supplied to the mine is maintained through a quality assurance program implemented during manufacture by M Props and the high quality material supplied to the manufacturer by their accredited suppliers.

4 Risk Assessment Process

For the original risk assessment in 2004, two workshops were held where the risk assessment team identified thirteen stages during the life cycle of a typical Medium Duty Camlok Prop. The top risk for each stage was the threat of injury to mining personnel through the use of the Medium Duty Camlok Prop. A probability of occurrence for each root cause was assigned by the risk assessment team on a subjective and judgemental basis. A probability of occurrence for each top fault was calculated using the fault tree method. This probability of occurrence was used as the base to determine the probability of mining personnel being injured or fatally injured whilst using the Medium Duty Camlok Prop. Finally a risk profile was compiled for the Medium Duty Camlok Prop benchmarked against the life time probability of being fatally injured in a public place or on public transport (Cole, 1993). For this revision, the probability of occurrence for each root cause was re-assessed in a meeting held at the M Props offices.

4.1 Medium Duty Camlok Prop Life Cycle

The life cycle of a Medium Duty Camlok Prop starts when an order is received from a mine by M Props for delivery and ends when the prop is declared not fit for purpose due to excessive 'wear and tear' and/or corrosion of the prop and removed from the work place (Figure 1).

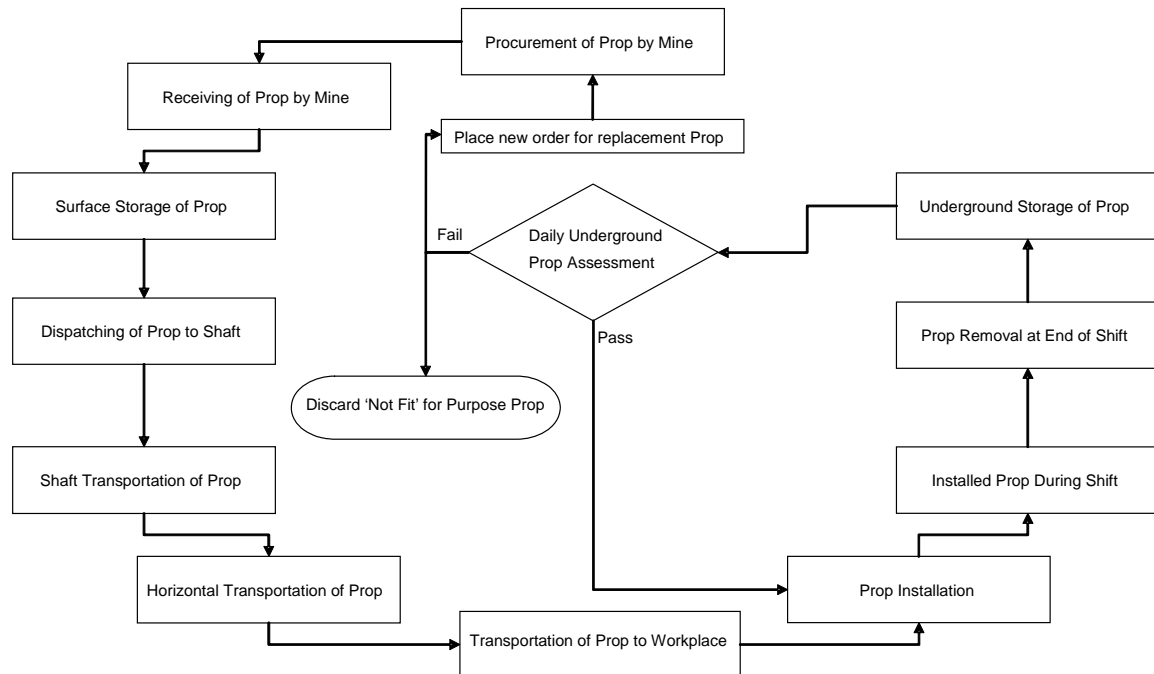


Figure 1: Life Cycle of the Medium Duty Camlok Prop

The hazards associated with each stage of the life cycle of the Medium Duty Camlok Prop were discussed and documented by the team during the workshops. Conclusions from these discussions are described for each stage of the life cycle, where the main risks associated with the use of the Medium Duty Camlok Prop are highlighted. The full risk assessment can be found in Appendix B.

4.1.1 Procurement Procedure

The hazards with the highest probability of occurrence associated with procurement of the Medium Duty Camlok Prop by the mine purchasing department are identified to be the following:

- **Incorrect type** of Camlok Prop ordered for the mine loading conditions is considered “**Low**” ~ (1.00×10^{-04}) ;
- **Incorrect length** of Camlok Prop ordered for the current panel stoping width or excavation size with regards to development ends or large excavations is considered “**Low**” ~ (1.00×10^{-04}) ;

The overall probability of occurrence of a threat of injury to mining personnel through the use of the Medium Duty Camlok Prop due to poor procurement procedures is considered “**Low**” ~ (3.31×10^{-04}) .

However, the mine should ensure that the type of Camlok Prop ordered is appropriate for the general loading conditions experienced on the mine, through a detailed rock engineering design and underground assessment. The changes made to the prop had no influence on these values.

4.1.2 *Receiving by Mine*

The hazards associated with this cycle of the prop’s life were seen as mainly being the off-loading of the prop at the stores from the delivery vehicle. The hazards identified are related to:

- **Lack of off-loading equipment** is considered “**Low**” ~ (5.00×10^{-04}) with the likelihood of hand and foot injuries to mine personnel due to falling or the dropping of props while off-loading.
- The probability of injuries occurring while **handling long props** is also considered to be “**Low**” ~ (1.00×10^{-04}) .
- **Late time of delivery** increases the probability of occurrence of a failure where labour may have already left for the day, leaving insufficient personnel to assist with the off-loading of the delivery vehicle. The probability of occurrence is considered “**Low**” ~ (1.01×10^{-04})

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor receiving practice by the mine is considered “**Low**” ~ (7.07×10^{-04}) .

However, the mine should ensure that sufficient labour and off-loading equipment is available in the receiving yard to safely off-load and transport the props to the storage yard. The availability of Personnel Protective Equipment (PPE) and training in correct handling of props will reduce the risk of injury to mine personnel. The changes made to the prop had no influence on these values.

4.1.3 *Surface Storage*

The team identified the main hazard associated with storage of the Medium Duty Camlok Prop at the mine’s storage facility as **weathering of props**, if stored out in the open. Weathering of props can cause the following:

- **Sun damage to props** can lead to peeling off of the identification label which contains information on the type of prop. Without this label the user

may be unable to identify the correct type of prop to be used. The probability of occurrence is considered “**Extremely Low**” ~ (1.00 x 10⁻⁰⁶)

- **Sun damage to Release Slings** can lead to fading of the colour coded slings, making it difficult for the user to identify the correct length of sling is considered “**Low**” ~ (1.00 x 10⁻⁰⁴).
- **Storage in mud / water** which may lead to premature corrosion of the prop and cam system is considered “**Extremely Low**” ~ (2.00 x 10⁻⁰⁶).

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor surface storage by the mine is considered “**Low**” ~ (2.08 x 10⁻⁰⁴).

However, the mine should ensure that the Medium Duty Camlok Props and accessories are stored under cover and not exposed to sun and rain. A procedure should be implemented which ensures correct stock rotation, with Last In, Last Out (LIFO) principle being applied. The changes made to the prop had no influence on these values.

4.1.4 *Dispatching to the Shaft*

The team agreed that the hazards associated with dispatching of the props to the shaft by the mine stores are similar to those identified during receiving by the mine. Although time of delivery is not an issue as the stores operate during set times and the hazards associated with rushing of loading may not exist.

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor dispatching procedures by the mine is considered “**Low**” ~ (7.06 x 10⁻⁰⁴). The changes made to the prop had no influence on these values.

4.1.5 *Shaft Transport*

This stage of the prop’s life cycle includes the transportation of the props in vertical or inclined shafts. The hazards identified by the team are:

- **Poor packing and stacking of props in material cars** could lead to prop handling injuries while unpacking was highlighted as being “**Medium**” with the probability of occurrence of (2.05 x 10⁻⁰³).
- **Poor slinging practice of long props** also poses the hazard of material falling down the shaft or catching on shaft steel work while in transit. Although the probability of occurrence is considered “**Extremely Low**” ~ (2.00 x 10⁻⁰⁶), the consequences could be disastrous.

- **Lack of shaft availability** was also highlighted as a potential problem as this would delay the arrival of the props at the designated workplace and lack of support units in the workplace increases the risk of injury to mine personnel or lost production. The probability of occurrence is considered “**Very Low**” ~ (2.00×10^{-05}) .

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor shaft transport procedures by the mine is considered “**Medium**” ~ (2.07×10^{-03}) . The changes made to the prop had no influence on these values.

The mine should ensure that appropriate procedures are in place regarding the packing and transportation of props, with emphasis on long props and slinging if required.

4.1.6 *Horizontal Transport*

This section of the risk assessment workshop focused on the hazards associated with the transportation of props in material cars in mine haulages to the work place. The team identified the two main hazards as being:

- **Poor packing of material cars** which may lead to props falling off material cars or protruding from the material car and able to strike mine personnel while being transported is considered to be “**Medium**” ~ (2.05×10^{-03}) .
- **Poor handling of long props** which may lead to protruding or falling of loose props from the material car is considered to be “**Medium**” ~ (2.00×10^{-03}) .

The overall probability of injuries occurring to mining personnel through the use of Medium Duty Camlok Props due to poor horizontal transport procedures by the mine is considered “**Medium**” ~ (4.24×10^{-03}) . The changes made to the prop had no influence on these values.

The mine should ensure that correctly sized material cars are available and correct packing and transport procedures are in place to ensure that this task is performed safely.

4.1.7 *Transport in the Workplace*

The team agreed that this was one of the important cycles of the prop’s life, as the props are transported manually by mine personnel or attached to mono winch ropes for transportation into the place of work. The main hazards identified and the associated values from the 2006 revision are:

- Injury while **transporting the props to the workplace** is identified as having a “**Medium**” ~ (7.25×10^{-03}) probability of occurrence with the following two categories:
 - Injury to mine personnel whilst the prop is being **transported by the mono winch system** is considered to be “**Medium**” ~ (1.23×10^{-03}) ;
 - Injury to mine personnel whilst **manually transporting** the prop to the workplace is considered to be “**Medium**” ~ (6.03×10^{-03}) .
- Poor **underground storage** in the timber bay **may** result in injury due to tripping and falling or falling props due to poor stacking is considered to be “**Medium**” ~ (4.40×10^{-03}) .
- When transporting props in tunnel development, **inclined development** is identified as having a slightly higher probability of occurrence (3.92×10^{-03}) when compared to that of horizontal development (1.72×10^{-03}) . This is due to the higher probability of injury caused by slipping and falling due to **poor footwall conditions** in inclined development areas.

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor transportation to the workplace is considered “**High**” ~ (1.72×10^{-02}) .

The mine should ensure that adequate procedures are in place for transportation of the Medium Duty Camlok Prop to the workplace via a mono winch system. If the props are to be manually transported to the workplace, the mine is to ensure that the travel distance is not excessive, is adequately ventilated, and there is sufficient clearance in which to travel.

4.1.8 Installation

The installation of the prop in the workplace has the highest probability of incident occurrence of all the stages of the Medium Duty Camlok Prop life cycle. This stage is sub-divided into the following hazards with the values of the 2006 revision given:

- **Poor “making safe”** which can result in a fall of ground accident which may also be triggered by disturbing the hangingwall whilst installing the prop is considered “**Low**” ~ (3.58×10^{-04}) ;

- **Poor footwall conditions** may cause the user to slip and fall while installing the prop as well as providing an unstable footing for the installed prop, which will reduce the prop's performance capabilities is considered **"High"** ~ (1.99×10^{-02}) ;
- **Poor permanent support installation** as a result of the permanent support not being installed to mine standard or already having worked beyond its capabilities, the installation of the Medium Duty Camlok Prop becomes more hazardous and is considered **"High"** ~ (1.00×10^{-02}) ;
- **Failure to examine prop condition** may result in unsafe work conditions by increasing the probability of fall of ground occurrences as the prop will not perform to the specified level or may not be installed due to being completely inoperable. The probability of occurrence is considered **"High"** ~ (1.99×10^{-02}) ;
- **Poor positioning of the prop** will result in insufficient support resistance being applied to the hangingwall or incorrect prop orientation which will increase the risk of removing the prop safely is considered **"High"** ~ (8.87×10^{-02}) ;
- **Failure to extend the outer tube and locate setting pin correctly** will result in poor performance of the prop due to an insufficient preload and the prop being easily dislodged is considered **"High"** ~ (5.20×10^{-02}) ;
- **Failure to pre-tension the cams correctly** will result in an insufficient preload on the props, allowing them to be easily dislodged is considered **"High"** ~ (2.05×10^{-02}) .

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop during installation in the workplace is considered **"Very High"** ~ (1.95×10^{-01}) .

The mine should ensure that all mine personnel required to use the Medium Duty Camlok Prop are trained correctly according to the lesson plan provided by M Props.

4.1.9 *Installed Prop*

This stage of the Medium Duty Camlok Prop covers the period when the Prop is installed and acting as temporary support in the workplace. The major hazards with the highest probability of occurrence are identified as:

- **Falls of ground** which may occur due to poor ground conditions or when the prop is dislodged as a result of block rotation of loose hanging wall, structural failure of the prop due to excessive loading, or lateral loading caused by a fall of ground. The probability of occurrence for this is considered **“High”** ~ (4.42×10^{-02}) .
- **Inappropriate support design** which may result in prop failure due to inappropriate prop type or insufficient load bearing capacity of the prop is considered **“High”** ~ (2.98×10^{-02}) . This hazard also includes lateral loading due to the installation of safety nets which may result in props being dislodged during a fall of ground.
- **Illegal removal** of an installed prop which normally occurs when the prop is deemed to be in the way, normally by the drill operator, is considered **“High”** ~ (6.10×10^{-02}) . This illegal removal of a prop **increases the probability of falls of ground** due to the **increased support span**. The human factor further increases the probability of failure, as the prop under these circumstances may not normally be removed in the appropriate safe manner as prescribed in the lesson plan.
- **Unapproved use of a prop other than for support purposes** may lead to falls of ground due to the prop being dislodged. Example: Rigging on an installed prop for cleaning purposes. The probability of occurrence is considered to be **“High”** ~ (1.00×10^{-02}) .

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop during the shift is considered to be **“Very High”** ~ (1.38×10^{-01}) . The changes made to the prop had no influence on these values.

The mine should ensure that all stope and development mine personnel are trained in the correct use of the Medium Duty Camlok Prop. The drill operators are to be made aware of the hazards involved with the illegal removal of the prop and the procedure to be followed if the prop needs to be removed. The mine is to ensure that appropriate support design is in place and that the Medium Duty Camlok Prop is used for the purpose that it is intended. If safety nets are to be implemented by the mine as a safety initiative, the mine must ensure that the lateral load capacity of the prop can comply with the maximum load bearing capacity of the safety net.

4.1.10 Prop Removal

The risk assessment process showed that prop removal is ranked third after prop installation and the installed prop during the shift. The major hazards identified for this cycle with the revised 2006 values are as follow:

- **Rockfall on person** which may occur during the release of the Camlok Prop, where the probability of injury to mine personnel is significantly increased if the prop is **not released remotely** or the **incorrect release sling length** is used. The probability of occurrence is considered **“Medium”** ~ (7.84×10^{-03})
- **Prop falling on person** due to **incorrect sling length** or **releasing prop from down dip position** is considered **“High”** ~ (1.10×10^{-02}) .
- **Injury of person due to strain** is considered to be **“Medium”** ~ (2.30×10^{-03})

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop while removing the prop after the shift is considered **“High”** ~ (2.10×10^{-02}) .

The mine should ensure that all mine personnel required to use the Medium Duty Camlok Prop are trained correctly according to the lesson plan provided by M Props.

4.1.11 Underground Storage

The main hazard associated with underground storage of the Medium Duty Camlok Prop is incorrect storage conditions leading to damage which may cause premature failure of the prop and its accessories. The potential types of damage which can lead to poor prop performance are:

- The probability of **blast damage** to the prop if stored in close proximity to the face area is considered to be **“Medium”** ~ (1.00×10^{-03}) ;
- The probability of **prop corrosion** when stored in wet muddy conditions, which may lead to defective cam operation and premature corrosion of the prop is considered to be **“Medium”** ~ (2.00×10^{-03}) .
- **Poor storage practice** may lead to injury to mine personnel through tripping and falling or falling props if the props are stored haphazardly. The probability of occurrence is considered to be **“Medium”** ~ (1.20×10^{-03}) ;

- **Scraper damage to the prop** may occur if the prop is stored in the path of the scraper or in contact with scraper ropes. The probability of occurrence is considered to be “**Medium**” ~ (1.00×10^{-03}) ;
- **Release sling failure** due to poor storage may lead to props being released without the use of a remote release sling, increasing the probability of a fall of ground injury. The probability of occurrence of sling failure due to damage is considered as “**Medium**” ~ (1.00×10^{-03}) .

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor underground storage is considered “**Medium**” ~ (8.17×10^{-03}) . The changes made to the prop had no influence on these values.

The mine should ensure that correct underground storage procedures are in place.

4.1.12 Daily Underground Prop Assessment

This is an important aspect of the Medium Duty Camlok Prop’s life cycle, as the performance of the prop depends on its condition and level of corrosion. The 2006 revision had an influence on the values given. The assessment should be done on a daily basis before prop installation to guard against the following:

- **Poor assessment of the physical condition of the prop and corrosion washer indicator** is considered “**High**” ~ (1.29×10^{-02}) .
- **Poor assessment of the physical condition of the release sling** is considered to have a “**Medium**” ~ (5.99×10^{-03}) probability of occurrence.

The overall probability of injuries occurring to mining personnel through the use of the Medium Duty Camlok Prop due to poor prop performance as a result of poor daily underground prop assessment is considered to be “**High**” ~ (1.88×10^{-02}) .

The mine should ensure that a checklist is included in the daily assessment of the Medium Duty Camlok Prop. Section 12 of the risk assessment in Appendix B lists the critical checks for the prop and should be incorporated into the daily check list.

4.1.13 Removal of ‘not fit for purpose’ Props

This is the final stage of the prop’s life cycle, when the daily prop assessment indicates that the prop is no longer fit for purpose. The prop should be removed from the workplace and transported to surface to be discarded. **Refurbishment of ‘not fit for purpose’ Medium Duty Camlok Props by**

the mine or a contractor is not encouraged and M Props accepts no responsibility whatsoever for poor performance or failure of refurbished Camlok Props.

4.2 Risk Profile

The probability of occurrence of the top fault, the threat to mine personnel while using the Medium Duty Camlok Prop is calculated for each identified stage of the life cycle. From this, the probability of a mine employee being injured or fatally injured can be calculated taking into account their exposure time and the potential severity of the hazard (Figure 2).

From this risk profile, it is clear that the risk of injury to mine personnel increases as the prop progresses through its life cycle towards the workplace and decreases after the prop has been removed from the workplace and stored for the next shift.

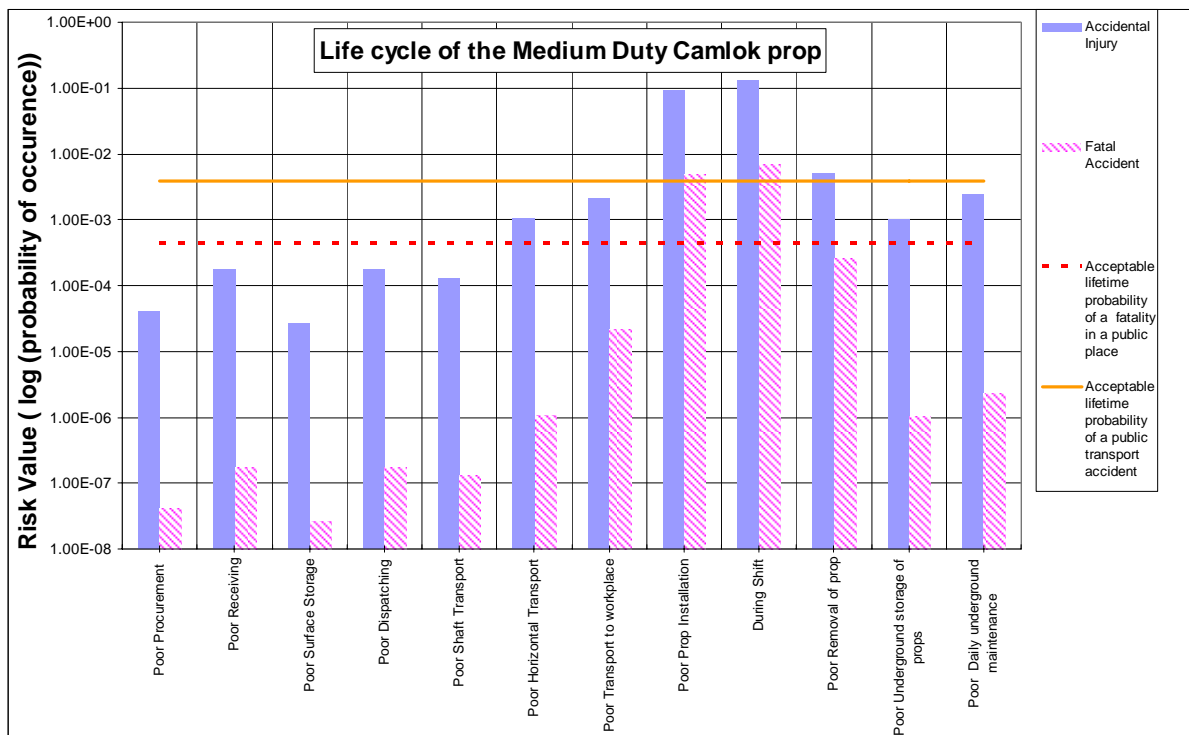


Figure 2: Risk profile of the Medium Duty Camlok Prop

Figure 2 shows a significant increase in the risk profile as the Medium Duty Camlok Prop enters the workplace. The indicated benchmarks are the acceptable lifetime probability of total loss in a public place and while using public transport (Cole, 1993). The probability of a fatal injury to mine personnel while using a Medium Duty Camlok Prop remains within acceptable limits, except for the installation, during the shift and removal of the prop. However, a mine employee trained in the correct use of the Medium Duty Camlok Prop should be aware of the hazards and risks associated with his/her daily tasks underground, making them more vigilant and thus reducing the risk to

themselves when compared to a general member of the public with a low awareness and little ability to reduce the risk of being fatally injured in a public place or on public transport.

5 Conclusions

The threat of injury to mine personnel through the use of the Medium Duty Camlok Prop was assessed during the study with the typical life cycle of the Prop described and documented in thirteen definable stages.

The probabilities of injuries occurring during each stage of the Medium Duty Camlok Prop's life cycle are determined, providing an overall probability of occurrence for the top risk, threat of injury to mine personnel through the use of a Medium Duty Camlok Prop.


A risk profile is compiled for the life cycle, where the threat of injury to mine personnel is determined by calculating the probability of injuries or fatal injuries occurring to mine personnel, taking into account the exposure of mine personnel to the hazards and the severity of the hazard. These probabilities are benchmarked against acceptable lifetime probabilities of being fatally injured in a public place or on public transport (Cole, 1993).

The risk profile for the Medium Duty Camlok Prop shows that the risk value for all the identified stages of the life cycle are within acceptable limits, except for the stages involving the installation of the prop i.e. the installation of the prop during the shift and removal of the prop after the shift.

The mine should ensure that strategies are in place to reduce or eliminate the risks associated with the identified hazards of the use of the Medium Duty Camlok Prop.



Stéfan Nortjé



Peter Terbrugge

SRK Consulting

Appendix A

General Description of the Risks Assessment Method

**GENERAL DESCRIPTION OF THE FAULT-EVENT TREE
ANALYSIS TECHNIQUE**

TABLE OF CONTENTS

| | | |
|----------|---|----------|
| | GLOSSARY OF TERMS AND DEFINITIONS | 1 |
| 1 | INTRODUCTION | 1 |
| 2 | CAUSE/FAULT TREE ANALYSIS | 1 |
| 3 | PROBABILITY EVALUATION IN FAULT TREE | 2 |
| 4 | EVENT TREE ANALYSIS | 3 |
| 5 | ALLOCATION OF PROBABILITIES OF OCCURRENCE..... | 3 |
| 6 | ACCEPTABLE PROBABILITY OF FAILURE..... | 6 |
| 7 | REFERENCES | 9 |

GLOSSARY OF TERMS AND DEFINITIONS

| | |
|------------------------------|---|
| Event, consequence | Potentially damaging consequences. It denotes the effects of the causative hazards, for example, injury to people or damage to machines and equipment. |
| Event tree analysis | An analysis that describes the possible range and sequence of the outcomes which may arise from an initiating event or top fault. The probability of occurrence of events is determined by considering the probability of occurrence of the top fault together with the relative weighting for the associated potentially adverse events. |
| Exposure | How often and for how long employees are exposed to a hazard. |
| Fatality accident rate (FAR) | The risk of death per 100 million hours of exposure to a dangerous activity. This is approximately the same as the probable number of fatalities from 1000 people involved in the activity for the whole of their working lives, each about 100 000 hours (50 years x 250 days/year x 8 hours/day). |
| Fault | Is a more general term than failure and can include the proper operation of an item at an inopportune time as well as the failure of an item to operate properly. |
| Fault Tree Analysis (FTA) | Is a technique, either qualitative or quantitative, by which sets of circumstances, which would need to co-exist, and can contribute to a specified undesired event (called the top event) are deductively identified, organised in a logical manner, and represented pictorially. |
| Gates | Show the relationships of faults needed for the occurrence of a higher fault. The higher fault is the output of the gate and the lower faults are the inputs to the gate. OR gates are used to show that the output fault occurs only if one or more of the input faults occur. AND gates are used to show that the output fault occurs only if all the input faults occur. |

| | |
|------------------------------------|--|
| Harm | Injury or loss |
| Hazard, cause, fault, threat | Something that has the potential to cause harm e.g. fall of ground from the hangingwall. |
| Lifetime probability of occurrence | The probable unit number of times to which any person would be exposed to a detrimental event during his/her whole life. It is directly related to the fatality accident rate, FAR. Expressed as a percentage, the lifetime probability of occurrence of an event is therefore equal to $FAR \times 100/1000 = 0,1 \times FAR$. |
| Primary faults | The primary categories in which the hazards to safety and health are considered e.g. threat of fall of ground due to bord collapse or threat of fall of ground due to pillar failure. |
| Probability of occurrence | The likelihood of a specific outcome, measured by the ratio of specific outcomes to the total number of possible outcomes. It is expressed as a number between 0 and 1, with 0 indicating an impossible outcome and 1 indicating an outcome is certain. |
| Risk | Is the product of the probability of occurrence of a hazard and the consequence of the hazard (severity of the damage of an event). |
| Risk analysis | A systematic use of available information to determine how often specific events may occur and the magnitude of their likely consequences (often interchangeably used for 'risk assessment'). |
| Risk assessment | The decision making process whereby a level of risk is compared against criteria and risks are prioritised for action. |
| Risk management | The systematic application of management policies, procedures and practices to the tasks of identifying, analysing, assessing, treating and monitoring risk. |

Secondary faults

The component hazards that can be identified in each of the primary categories of hazards/faults e.g. with regard to the threat of a fall of ground due to bord collapse would be fall of ground originating from the hangingwall and fall of ground originating from the sidewall.

Tertiary faults

The component hazards that can be identified in each of the secondary categories of hazards/faults e.g. with regard to fall of ground from the hangingwall would be fall of ground from the hangingwall in the face area, fall of ground from the hangingwall in the back area, or fall of ground from the hangingwall at intersections.

1 INTRODUCTION

The failure of any system, e.g. a fall of ground in an underground excavation, is seldom the result of a single **cause** or **fault**. Failure usually results after a combination of faults occur in such a way that the factor of safety of the system falls to below unity. A disciplined and systematic approach is therefore required to determine the correct logic that controls the failure of the system and to analyse the potential consequences of failure. One such approach, the **Fault-Event Tree Analysis**, is discussed here.

2 CAUSE/FAULT TREE ANALYSIS

Fault Tree Analysis (FTA) is a quantitative or qualitative technique by which conditions and factors that can contribute to a specified undesired incident (called the **top fault**) are deductively identified, organised in a logical manner, and presented pictorially. It can also be defined as a deductive failure analysis which focuses on one particular undesired fault and which provides a method for determining causes of the fault.

FTA affords a disciplined approach that is highly systematic, but at the same time sufficiently flexible to allow analysis of a variety of factors. The application of the top-down approach focuses attention on those effects of failure that are directly related to the top fault. FTA is especially useful for analysing systems with many interfaces and interactions. The pictorial representation leads to an easy understanding of the system behaviour and the factors included, but as trees are often large, processing of fault trees may require computer systems.

Starting with the top fault, the possible causes or failure modes (**primary faults**) on the next lower system level are identified. Following the step-by-step identification or undesirable system operation to successively lower levels, **secondary faults**, **tertiary faults**, etc. are identified.

In order to determine the correct logic that controls the failure of the system, the faults are not initially given probabilities of occurrence. In this form the “tree” is referred to as a “**cause tree**”. Once the cause tree is considered to correctly reflect the combinations of faults necessary to result in failure, probabilities are either calculated or assigned to the faults. In this form, the “tree” is referred to as a “**fault tree**”.

Thus, a fault tree represents a quantitative or qualitative evaluation of the probabilities of various faults leading to the calculation of the **top faults**, which result in failure of the system. The objective of the fault tree is to identify and model the various system conditions that can result in the top fault (e.g. threat of FOG in East Block due to bord collapse).

3 PROBABILITY EVALUATION IN FAULT TREE

The fault tree is a complex of entities known as **gates** which serve to permit or inhibit the passage of fault logic up the tree. The gates show the relationships of faults needed for the occurrence of a higher fault. **AND** gates and **OR** gates denote the type of relationship of the input events required for the output event.

- AND gates are used where faults are statistically dependent. If it is necessary for n secondary faults to occur in order for a primary fault to result, then the probability of occurrence, p , is represented by:

$$p[\textit{primary fault}] = p[\textit{secondary fault 1}] \times p[\textit{secondary fault 2}] \times \dots \times p[\textit{secondary fault n}]$$

- OR gates are used where faults are statistically independent. If a primary fault can result as a consequence of the occurrence of any n secondary faults, then the probability of occurrence is determined from the calculation as follows:

$$p[\textit{primary fault}] = 1 - (1 - p[\textit{secondary fault 1}]) \times (1 - p[\textit{secondary fault 2}]) \dots (1 - p[\textit{secondary fault n}])$$

4 **EVENT TREE ANALYSIS**

The potential damaging consequences of a top fault is known as **events** and the systematic display of the events is referred to as an **event tree**. The probability of occurrence of a top fault together with relative weighting for the associated potentially adverse events, enable their likely occurrence to be determined. The product of the probability of occurrence and severity of the damage of an event is defined as the **risk**.

The systematic nature of the fault event tree enables the sensitivities of the potentially adverse consequences to any of the causative hazards to be evaluated. This enables the most threatening causative hazards to be identified and eliminatory measures to be defined.

5 **ALLOCATION OF PROBABILITIES OF OCCURRENCE**

Three measures are available for measuring reliability in engineering design, viz:

- the factor of safety;
- the reliability index, and;
- the probability of failure.

The factor of safety is a clearly understood and a numerically sensitive measure. It is, however, not a consistent measure and is not determined in terms of consistent processes. The reliability index is a consistent measure and is based on consistent processes for determining operational values. Its meaning is, however, not clearly understood. It is also not numerically sensitive, especially not with regard to higher orders of reliability.

The probability of failure is a consistent and numerically sensitive measure and is based on consistent processes for the determination of operational values. The numerical sensitivity of the probability of failure, however, detracts from the clarity of its meaning. The probabilities of various kinds of losses of life, property, etc. vary exponentially over many orders of magnitude between very large and very small values. The meaning of such a measure is often difficult to understand.

The difficulties that designers have in selecting acceptable thresholds for probability of failure can be resolved by using the norms and guidelines for selecting acceptable probabilities of failure for design, presented in a paper entitled: “Review of norms for probability of failure and risk in engineering design”, (Kirsten, 1994). Acceptable probabilities of failure are discussed further in Section 6.

The acceptable lifetime probabilities of total loss of life described in this paper by Kirsten are summarised in Table 1 below. Also included in the table are the corresponding probabilities assigned to hazards associated with the installation of rockbolts.

Table 2 Acceptable lifetime probabilities of total loss of life and corresponding probabilities assigned to hazards.

| Degree of risk / Probability of occurrence | Acceptable lifetime probabilities (after Cole, 1993) |
|--|--|
| Very Risky / Certain (C) | 7×10^0 |
| Risky / Very high (VH) | 7×10^{-01} |
| Some risk / High (H) | 7×10^{-02} |
| Slight chance / Medium (M) | 7×10^{-03} |
| Unlikely / Low (L) | 7×10^{-04} |
| Very unlikely / Very low (VL) | 7×10^{-05} |
| Practically impossible / Extremely low (EL) | 7×10^{-06} |
| Practically zero (PZ) | 7×10^{-07} |

In certain cases, probabilities of occurrence could also be determined more accurately by assigning probability density functions to primary faults. This is particularly important in geotechnical engineering designs where input parameters, especially those that are effected by geology, are often not known accurately and the influence of their variability should be accounted for. However, probabilistic analyses of multiple variables require sophisticated numerical techniques that are beyond the scope of this project.

A simplified approach is to assign probabilities based on engineering judgement and past experience with this type of work. Probabilities assigned to certain levels of risk as described in Table 1 could be used as a guideline. The final result will then show if a more accurate assessment of the probability of occurrence would be necessary. It is likely that the detailed assessment will only be required for key sensitive areas which will be revealed by sensitivity analysis.

It is important to note that probabilities of occurrence may not have unique or discrete values. It is possible for a probability of a particular fault (or event) to change in sympathy with another probability that it is coupled with. This is best illustrated by means of an example:

Take the example of a “wrong support installation procedure” being used in an underground excavation. The probability of a wrong support installation procedure being used depends upon the probability that:

- *the knowledge about the correct support installation procedure is lacking, or;*
- *the equipment being used for support installations is out of order, or;*
- *the discipline and supervision are poor.*

The probability that the knowledge about the correct support installation procedure is lacking in turn depends on the probability that:


- *the support installation procedure is not defined by the mine’s standards, or;*
- *the support installation procedure is not communicated to the workers, or;*
- *the workers are incompetent.*

The probability that the workers are incompetent depends on the probability that:

- *inadequate training is provided, or;*
- *the workers are untrainable.*

The probability of a wrong support installation procedure being used could be different for different parts or sections of the mine. For example, the equipment being used for support installation in one section could be more reliable than the equipment being used in another section.

The probability of a wrong support installation procedure being used can be represented as follows:

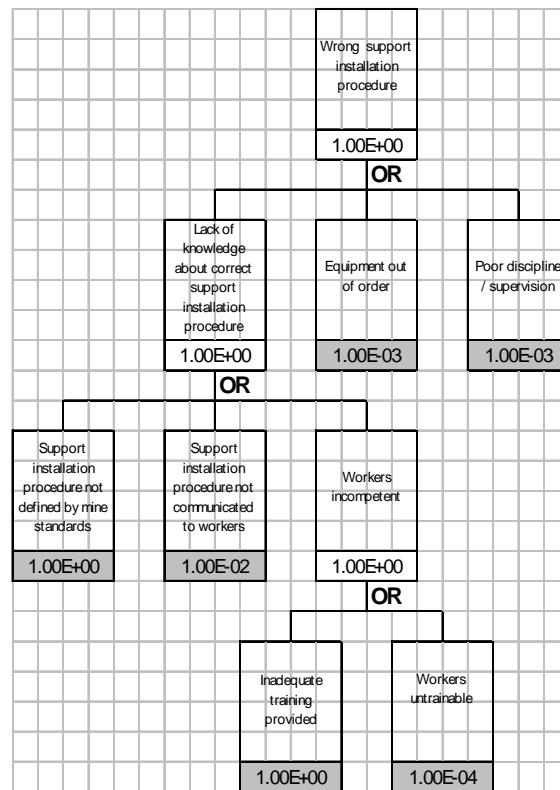

6 ACCEPTABLE PROBABILITY OF FAILURE

The use of probability of failure is a means of incorporating acceptable and tolerable levels of risk into engineering designs. As mentioned before, risk is the product of the probability of failure and the consequence of an unwanted event, in this case, falls of ground.

The acceptability of probabilities of failure for particular design applications can be evaluated in terms of the magnitudes and distributions of actual frequencies of total losses of life, property and money. For example, the lifetime frequencies of fatalities due to unstable ground in gold and coal mines in South Africa in 1993 amounted to approximately 7,9% and 2,8% respectively (Kirsten, 1994). (These correspond with fatality rates/1000 at work of 0,76 and 0,37 respectively.)

According to Cole (1993), an acceptable lifetime probability of loss of life in respect of voluntary employment in underground mines would be 0,7%. This would bring about a 10 fold reduction in

the number of fatalities in metalliferous mines and a 4 fold reduction in the number of fatalities in coal mines.

The lifetime frequency of a detrimental event represents the probable unit number of times to which any person would be exposed to it during his/her whole life. It is directly related to the fatality accident rate, FAR, defined by Hambly and Hambly (1994) as the risk of death per 100 million hours of exposure to a dangerous activity. This is approximately the same as the probable number of fatalities from 1000 people involved in the activity for the whole of their working lives, each about 100 000 hours (50 years x 250 days/year x 8 hours/day). Expressed as a percentage, the lifetime probability of occurrence of an event is therefore equal to $FAR \times 100/1000 = 0,1 \times FAR$. This measure enables losses from different occupations to be compared on a common basis. It also enables exposures to losses for part of a day to be compared to full time exposures.

When the consequences of failure are serious, a reduced probability of failure needs to be adopted in order to achieve an acceptable level of risk, e.g., when mining a panel of pillars, the normal acceptable level of risk in terms of probability of failure is 3 in 1000 (Galvin et al, 1998). However, this probability of failure would be unacceptable for a more serious consequence of failure, such as flooding of the workings. In this case, a probability of failure of at least 1 in 100 000 may be chosen as representative of the tolerable level of risk, considering the seriousness of the consequences.

Other recommendations for acceptable probabilities of failure found in the literature can be summarised as follows:

- According to Galvin et al (1998), a probability of coal pillar failure of 3 in 1000 relates to a FOS of 1,59, and a probability of failure of 1 in 100 relates to a FOS of 1,48. This correlation is based on data from the Australian coalfields.
- According to the back-analysis carried out by Salamon and Wagner (1984), the rate of coal pillar failure in South Africa had been 0,003, which compared with the predicted probability of pillar failure of 0,003 for a FOS of 1,6.
- D'Andrea and Sangrey (1982) have shown that probabilities of slope failure of 0,1; 0,01 and 0,001 correspond with factors of safety ranging from 1,25 to 1,93; 1,43 to 3,13 and 1,58 to 4,49 respectively.
- According to Cole (1993), an acceptable life-time probability of loss of life in respect of voluntary employment in underground mines would be 0,7% or 0,007.

Kirsten (1994) suggests that acceptable levels for probabilities of failure for which designs may be prepared should be significantly smaller than the actual probabilities of failure observed for similar situations. This is required to account for the following aspects.

1) Natural aversion to involuntary total loss

Slovic (1987) found that the acceptability of risk is related to the benefits of the activity and the voluntary or involuntary nature thereof. Public aversion to risk is also related to the number of people involved. The design engineer should take note of these aspects when selecting a value for the probability of failure for a particular case.

2) Variations in perceptions

Slovic (1987) found that risk means different things to different people, depending on their background. Selecting a value for probability of failure should take cognisance of the variations in the perceptions of risk, but need not cater unduly for misconceptions on the part of the public.

3) Non-representativeness of actual comparative probabilities of failure

The design engineer should take note of the scatter of various acceptable probabilities of failure.

4) Variations in parameter values and biases in calculation procedures

Design engineers should be aware of the effects of variations in parameter values on the reliability of the probability of failure that may be determined.

5) Deficiencies in design data

Ground conditions are known to carry potentially high risks and uncertainty. According to Sowers (1993) a study of 500 geotechnical failures revealed that 88% of the failures were produced by human shortcomings and that 75% of the failures originated in the design process. Whyte and Tonks (1993) submit that these problems are directly and largely attributable to deficiencies in the site investigations undertaken for design purposes.

Acceptable probabilities of failure cannot be prescribed. Each mine should therefore decide on a value for probability of rockfall accidents that would be acceptable to the mine. In the mean time, SRK suggests that a value of 0,003 or 0,3% be used as an acceptable probability of a rock fall incident occurring. The lifetime probability of total loss of life should therefore be a few orders of magnitude smaller than the acceptable levels suggested by Cole (1993). This corresponds with Kirsten's (1994) suggestion that acceptable levels for probabilities of failure for which designs may be prepared should be significantly smaller than the actual probabilities of failure observed for similar situations.

7 REFERENCES

- 1) Roberts, N.H., Vesely, W.E., Haasl, D.F. and Goldberg, F.F. (1981). *Fault Tree Handbook*. NUREG-0492. U.S. Nuclear Regulatory Commission. Washington, D.C. 202 pages.
- 2) Greenberg, H.R. and Salter, B.B. (19??). Fault Tree and Event Tree analysis. *Risk Assessment for the Chemical Process Industry*. pp 127-166
- 3) Kirsten, H.A.D. (1994). Review of norms for probability of failure and risk in engineering design.
- 4) Cole, K. (1993). Building over abandoned shallow mines. Paper 1: Considerations of Risk and Reliability. *Ground Engineering*, pp 35-37.
- 5) D'Andrea, R.A.D. and Sangrey, D.A. (1982). Safety factors for probabilistic slope design. *Journal of the Geotechnical Engineering Division*. Proceedings of the American Society of Civil Engineers, Volume 108, No. GT9, pp 1101-1116.
- 6) Hambly, E.C. and Hambly, M.A. (1994). Risk evaluation and realism. Proceedings Institution of Civil Engineers, *Civil Engineering*, Volume 102, pp 64-71.

Appendix B

Detailed Risk Assessment

1. Procurement Procedure

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 12.5% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 4.13E-08 |
| Risk of injury (number of people injured) | 4.13E-05 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - Rev 2006 |

| FAULT TREE ANALYSIS | | |
|---|---------------------------|--------------------|
| | Probability of Occurrence | Comments / Remarks |
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | 3.31E-04 | |
| 1 Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor procurement procedures | 3.31E-04 | |
| 1.1 Incorrect Camlok prop supplied to the mine OR | 2.21E-04 | |
| 1.1.1 Incorrect order received by MProps OR | 2.02E-05 | |
| 1.1.1.1 Incorrect stock code used OR | 1.01E-05 | |
| 1.1.1.1.1 Camlok unit not loaded on purchasing systemOR | 1.00E-07 | PZ |
| 1.1.1.1.2 No stock available | 1.00E-05 | VL |
| 1.1.1.2 Incorrect unit description used OR | 1.01E-05 | |
| 1.1.1.2.1 Camlok unit not loaded on purchasing systemOR | 1.00E-07 | PZ |
| 1.1.1.2.2 No stock available | 1.00E-05 | VL |
| 1.1.2 Incorrect specification received by purchasing department | 2.00E-04 | |
| 1.1.2.1 Incorrect stock code used when ordering by mining personnelOR | 1.00E-04 | |
| 1.1.2.1.1 Camlok unit not loaded on purchasing systemOR | 1.00E-07 | PZ |
| 1.1.2.1.2 No stock available OR | 1.00E-07 | PZ |
| 1.1.2.1.3 Incorrect type of Camlok ordered OR | 1.00E-04 | L |
| 1.1.2.1.4 Incorrect unit length ordered for mine excavation width | 1.00E-04 | L |
| 1.1.2.2 Incorrect unit description used when ordering by mining personnel OR | 1.00E-04 | |
| 1.1.2.2.1 Camlok unit not loaded on purchasing systemOR | 1.00E-07 | PZ |
| 1.1.2.2.2 No stock available OR | 1.00E-07 | PZ |
| 1.1.2.2.3 Incorrect type of Camlok ordered OR | 1.00E-07 | PZ |
| 1.1.2.2.4 Incorrect unit length ordered for mine excavation width | 1.00E-04 | L |
| 1.2 Incorrect support design | 1.10E-04 | |
| 1.2.1 Inappropriate type of Camlok prop recommended | 1.10E-04 | |
| 1.2.1.1 Incorrect unit description | 1.10E-04 | |
| 1.2.1.1.1 Lack of knowledge of loading conditionsOR | 1.00E-04 | L |
| 1.2.1.1.2 No stock available | 1.00E-05 | VL |

2. Receiving by Mine

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 25.0% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 1.77E-07 |
| Risk of injury (number of people injured) | 1.77E-04 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

FAULT TREE ANALYSIS

| | | Probability of Occurrence | Comments / Remarks |
|---|---|---------------------------|--------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | 7.07E-04 | |
| 2 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor receiving practice by the mine | 7.07E-04 | |
| 2.1 | Poor Packing OR | 1.06E-04 | |
| 2.1.1 | Falling material OR | 1.04E-04 | |
| 2.1.1.1 | Material falling off the truck during transportation OR | 2.10E-06 | |
| 2.1.1.1.1 | Failure of strapping OR | 1.00E-06 | EL |
| 2.1.1.1.2 | Pallet shifting OR | 1.00E-06 | EL |
| 2.1.1.1.3 | Gate of the truck opening | 1.00E-07 | PZ |
| 2.1.1.2 | Material falling and striking a person while off loading | 1.02E-04 | |
| 2.1.1.2.1 | Pallet shifting OR | 1.00E-06 | EL |
| 2.1.1.2.2 | Poor long material handling OR | 1.00E-04 | L |
| 2.1.1.2.3 | Failure of strapping | 1.00E-06 | EL |
| 2.1.2 | Shifted material | 2.20E-06 | |
| 2.1.2.1 | Material falling due to lack of handling space OR | 2.00E-06 | |
| 2.1.2.1.1 | Failure of strapping OR | 1.00E-06 | EL |
| 2.1.2.1.2 | Loose material | 1.00E-06 | EL |
| 2.1.2.2 | Unable to off load due to lack of access | 2.00E-07 | |
| 2.1.2.2.1 | Failure of strapping OR | 1.00E-07 | PZ |
| 2.1.2.2.2 | Loose material | 1.00E-07 | PZ |
| 2.2 | Lack of off-loading equipment OR | 5.00E-04 | |
| 2.2.1 | Poor handling practice | 5.00E-04 | |
| 2.2.1.1 | Injury due to manual labour OR | 2.00E-04 | |
| 2.2.1.1.1 | Falling Material OR | 1.00E-04 | L |
| 2.2.1.1.2 | Body Strain | 1.00E-04 | L |
| 2.2.1.2 | Falling material due to lack of handling capabilities | 3.00E-04 | |
| 2.2.1.2.1 | Insufficient labour to off load material OR | 1.00E-04 | L |
| 2.2.1.2.2 | Poor long material handling OR | 1.00E-04 | L |
| 2.2.1.2.3 | Damage to props while off loading | 1.00E-04 | L |
| 2.3 | Late delivery | 1.01E-04 | |
| 2.3.1 | Rushing of off loading | 1.01E-04 | |
| 2.3.1.1 | Falling material | 1.01E-04 | |
| 2.3.1.1.1 | Insufficient labour to off load material due to late delivery OR | 1.00E-06 | EL |
| 2.3.1.1.2 | Poor long material handling | 1.00E-04 | L |

3. Surface Storage

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 12.5% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 2.60E-08 |
| Risk of injury (number of people injured) | 2.60E-05 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

| FAULT TREE ANALYSIS | | | Probability of Occurrence | Comments / Remarks |
|---|--|--|---------------------------|--------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | | 2.08E-04 | |
| 3 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor storage on surface. | | 2.08E-04 | |
| 3.1 | Poor packing OR | | 1.90E-06 | |
| 3.1.1 | Falling props OR | | 1.50E-06 | |
| 3.1.1.1 | Material falling during storage OR | | 1.20E-06 | |
| 3.1.1.1.1 | Failure of strapping OR | | 1.00E-07 | PZ |
| 3.1.1.1.2 | Pallet failure OR | | 1.00E-06 | EL |
| 3.1.1.1.3 | Stack falling over | | 1.00E-07 | PZ |
| 3.1.1.2 | Material falling and striking a person during storage | | 3.00E-07 | |
| 3.1.1.2.2 | Pallet shifting OR | | 1.00E-07 | PZ PPE |
| 3.1.1.2.3 | Poor long material handling OR | | 1.00E-07 | PZ |
| 3.1.1.2.4 | Failure of strapping | | 1.00E-07 | PZ |
| 3.1.2 | Shifted material | | 4.00E-07 | |
| 3.1.2.1 | Material falling due to lack of handling space OR | | 2.00E-07 | |
| 3.1.2.1.1 | Failure of strapping OR | | 1.00E-07 | PZ |
| 3.1.2.1.2 | Loose material | | 1.00E-07 | PZ |
| 3.1.2.2 | Unable to transport due to lack of access | | 2.00E-07 | |
| 3.1.2.2.1 | Failure of strapping OR | | 1.00E-07 | PZ |
| 3.1.2.2.2 | Loose material | | 1.00E-07 | PZ |
| 3.2 | Weathering of props OR | | 1.03E-04 | |
| 3.2.1 | Poor storage practice | | 1.03E-04 | |
| 3.2.1.1 | Sun damage to props OR | | 1.00E-06 | |
| 3.2.1.1.1 | Identification stickers peel off | | 1.00E-06 | EL |
| 3.2.1.2 | Sun damage to release sling OR | | 1.00E-04 | |
| 3.2.1.2.1 | Breakage during surface storage | | 1.00E-04 | L |
| 3.2.1.3 | Storage in mud or water | | 2.00E-06 | |
| 3.2.1.3.1 | Cam mechanism is defective due to mud accumulation OR | | 1.00E-06 | EL |
| 3.2.1.3.2 | Cam mechanism is defective due to corrosion | | 1.00E-06 | EL |
| 3.3 | Unbundling of props OR | | 1.01E-04 | |
| 3.3.1 | Falling props | | 1.01E-04 | |
| 3.3.1.1 | Falling material | | 1.01E-04 | |
| 3.3.1.1.1 | Insufficient labour OR | | 1.00E-06 | EL |
| 3.3.1.1.2 | Poor long material handling OR | | 1.00E-06 | EL |
| 3.3.1.1.3 | Hand injuries | | 1.00E-04 | L |
| 3.4 | Poor inventory control | | 2.00E-06 | |
| 3.4.1 | Inadequate stock | | 2.00E-06 | |
| 3.4.1.1 | Failure to supply section | | 2.00E-06 | |
| 3.4.1.1.1 | Lost Blast OR | | 1.00E-06 | EL |
| 3.4.1.1.2 | Workplace not supported to mine standard | | 1.00E-06 | EL |

4. Dispatching to the Shaft

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 25.0% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 1.76E-07 |
| Risk of injury (number of people injured) | 1.76E-04 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

| FAULT TREE ANALYSIS | | | | |
|---------------------|---|---------------------------|----|--------------------|
| | | Probability of Occurrence | | Comments / Remarks |
| | | | | |
| | Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | 7.06E-04 | | |
| 4 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor dispatching procedures by the mine | 7.06E-04 | | |
| | 4.1 Poor Packing OR | 1.06E-04 | | |
| | 4.1.1 Falling material OR | 1.04E-04 | | |
| | 4.1.1.1 Material falling off the material car during transportation OR | 2.00E-06 | | |
| | 4.1.1.1.1 Failure of strapping OR | 1.00E-06 | EL | |
| | 4.1.1.1.2 Pallet shifting | 1.00E-06 | EL | |
| | 4.1.1.2 Material falling and striking a person while loading | 1.02E-04 | | |
| | 4.1.1.2.2 Pallet shifting OR | 1.00E-06 | EL | |
| | 4.1.1.2.3 Poor long material handling OR | 1.00E-04 | L | |
| | 4.1.1.2.4 Failure of strapping | 1.00E-06 | EL | |
| | 4.1.2 Shifted material | 2.20E-06 | | |
| | 4.1.2.1 Material falling due to lack of handling space OR | 2.00E-06 | | |
| | 4.1.2.1.1 Failure of strapping OR | 1.00E-06 | EL | |
| | 4.1.2.1.2 Loose material | 1.00E-06 | EL | |
| | 4.1.2.2 Unable to load due to lack of access | 2.00E-07 | | |
| | 4.1.2.2.1 Failure of strapping OR | 1.00E-07 | PZ | |
| | 4.1.2.2.2 Loose material | 1.00E-07 | PZ | |
| | 4.2 Lack of loading equipment OR | 5.00E-04 | | |
| | 4.2.1 Poor handling practice | 5.00E-04 | | |
| | 4.2.1.1 Injury due to manual labour OR | 2.00E-04 | | |
| | 4.2.1.1.1 Falling Material OR | 1.00E-04 | L | |
| | 4.2.1.1.2 Body Strain | 1.00E-04 | L | |
| | 4.2.1.2 Falling material due to lack of handling capabilities | 3.00E-04 | | |
| | 4.2.1.2.1 Insufficient labour to load material OR | 1.00E-04 | L | |
| | 4.2.1.2.2 Poor long material handling OR | 1.00E-04 | L | |
| | 4.2.1.2.3 Damage to props while loading | 1.00E-04 | L | |
| | 4.3 Late dispatching | 1.01E-04 | | |
| | 4.3.1 Rushing of loading | 1.01E-04 | | |
| | 4.3.1.1 Falling material | 1.01E-04 | | |
| | 4.3.1.1.1 Insufficient labour to load material due late dispatching OR | 1.00E-06 | EL | |
| | 4.3.1.1.2 Poor long material handling | 1.00E-04 | L | |

5. Shaft Transport

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 6.3% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 1.29E-07 |
| Risk of injury (number of people injured) | 1.29E-04 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - Rev 2006 |

| FAULT TREE ANALYSIS | | | Probability of Occurrence | Comments / Remarks |
|---|---|---|---------------------------|--------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | | 2.07E-03 | |
| 5 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor shaft transport procedures by the mine | | 2.07E-03 | |
| | 5.1 | Poor packing of material cars OR | 2.05E-03 | |
| | 5.1.1 | Falling material | 2.05E-03 | |
| | 5.1.1.1 | Props falling out of material cars during transportation OR | 1.03E-03 | |
| | 5.1.1.1.1 | Poor packing of material cars OR | 1.00E-05 | VL |
| | 5.1.1.1.2 | Material cars too short OR | 1.00E-05 | VL |
| | 5.1.1.1.3 | Poor long material handling OR | 1.00E-03 | M |
| | 5.1.1.1.4 | Over loading | 1.00E-05 | VL |
| | 5.1.1.2 | Material falling and striking a person while off-loading | 1.02E-03 | |
| | 5.1.1.2.2 | Poor packing of material cars OR | 1.00E-05 | VL |
| | 5.1.1.2.3 | Poor long material handling OR | 1.00E-03 | M |
| | 5.1.1.2.4 | Over loading | 1.00E-05 | VL |
| | 5.2 | Poor handling of long props OR | 2.00E-06 | |
| | 5.2.1 | Poor handling practice | 2.00E-06 | |
| | 5.2.1.1 | Poor Slinging | 2.00E-06 | |
| | 5.2.1.1.1 | Falling Material OR | 1.00E-06 | EL |
| | 5.2.1.1.2 | Falling bogie | 1.00E-06 | EL |
| | 5.3 | Lack of shaft availability | 2.00E-05 | |
| | 5.3.1 | Props not transported when required | 2.00E-05 | |
| | 5.3.1.1 | Failure to supply the section | 2.00E-05 | |
| | 5.3.1.1.1 | Lost blast OR | 1.00E-05 | VL |
| | 5.3.1.1.2 | Workplace not supported to mine standard | 1.00E-05 | VL |

6. Horizontal Transport

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 25.0% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 1.06E-06 |
| Risk of injury (number of people injured) | 1.06E-03 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - Rev 2006 |

| FAULT TREE ANALYSIS | | |
|---|---------------------------|--------------------|
| | Probability of Occurrence | Comments / Remarks |
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | 4.24E-03 | |
| 6 Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor horizontal transport procedures by the mine | 4.24E-03 | |
| 6.1 Poor packing of material cars OR | 2.05E-03 | |
| 6.1.1 Falling material | 2.05E-03 | |
| 6.1.1.1 Props falling out of material cars during transportation OR | 1.03E-03 | |
| 6.1.1.1.1 Poor packing of material cars OR | 1.00E-05 | VL |
| 6.1.1.1.2 Material cars too short OR | 1.00E-05 | VL |
| 6.1.1.1.3 Poor long material handling OR | 1.00E-03 | M |
| 6.1.1.1.4 Over loading | 1.00E-05 | VL |
| 6.1.1.2 Material falling and striking a person while off-loading | 1.02E-03 | |
| 6.1.1.2.2 Poor packing of material cars OR | 1.00E-05 | VL |
| 6.1.1.2.3 Poor long material handling OR | 1.00E-03 | M |
| 6.1.1.2.4 Over loading | 1.00E-05 | VL |
| 6.2 Poor handling of long props OR | 2.00E-03 | |
| 6.2.1 Poor handling practice | 2.00E-03 | |
| 6.2.1.1 Poor packing | 2.00E-03 | |
| 6.2.1.1.1 Falling Material OR | 1.00E-03 | M |
| 6.2.1.1.2 Loose material | 1.00E-03 | M |
| 6.3 Lack of transport availability | 2.00E-04 | |
| 6.3.1 Props not transported when required | 2.00E-04 | |
| 6.3.1.1 Failure to supply the section | 2.00E-04 | |
| 6.3.1.1.1 Lost blast OR | 1.00E-04 | L |
| 6.3.1.1.2 Workplace not supported to mine standard | 1.00E-04 | L |

7. Transport to the Workplace

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 12.5% |
| Exposure results in fatal accidents (%) | 1 |
| Exposure results in injuries only (%) | 99 |
| Risk of fatal accident (number of fatal accidents) | 2.15E-05 |
| Risk of injury (number of people injured) | 2.13E-03 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - Rev 2006 |

| FAULT TREE ANALYSIS | | | Probability of Occurrence | Comments / Remarks |
|---|--|--|---------------------------|--------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | | 1.72E-02 | |
| 7 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor transportation to the workplace | | 1.72E-02 | |
| | 7.1 Transportation to working place | | 1.72E-02 | |
| | 7.1.1 Poor storage in timber bay OR | | 4.40E-03 | |
| | 7.1.1.1 Falling material OR | | 2.20E-03 | |
| | 7.1.1.1.1 Poor stacking OR | | 1.00E-04 | L |
| | 7.1.1.1.2 Poor off loading OR | | 1.00E-04 | L |
| | 7.1.1.1.3 Poor long material handling OR | | 1.00E-03 | M |
| | 7.1.1.1.4 Lack of storage space | | 1.00E-03 | M |
| | 7.1.1.2 Trip and fall OR | | 2.20E-03 | |
| | 7.1.1.2.1 Poor packing of material OR | | 1.00E-04 | L |
| | 7.1.1.2.2 Poor long material storage OR | | 1.00E-03 | M |
| | 7.1.1.2.3 Loose material OR | | 1.00E-04 | L |
| | 7.1.1.2.4 Confined travelling space | | 1.00E-03 | M |
| | 7.1.1.3 Material Corrosion OR | | 2.00E-06 | |
| | 7.1.1.3.1 Cam mechanism is defective due to mud accumulation OR | | 1.00E-06 | EL |
| | 7.1.1.3.2 Cam mechanism is defective due to corrosion | | 1.00E-06 | EL |
| | 7.1.1.4 Damage to prop while being stored | | 1.00E-06 | EL |
| | 7.1.2 Transport to stope OR | | 7.25E-03 | |
| | 7.1.2.1 Transportation by mono winch rope OR | | 1.23E-03 | |
| | 7.1.2.1.1 Poor attachment of prop to mono winch rope OR | | 1.00E-05 | VL |
| | 7.1.2.1.2 Hand injuries while handling and attaching prop to mono winch rope OR | | 1.00E-04 | L |
| | 7.1.2.1.3 Props striking a worker while in transit OR | | 1.00E-03 | M |
| | 7.1.2.1.4 Damage of loose parts of prop while in transit OR | | 1.00E-05 | VL |
| | 7.1.2.1.5 Moving parts of prop causing injury to personnel OR | | 1.00E-05 | VL |
| | 7.1.2.1.6 Poor removal of prop from mono winch rope at workplace, causing damage to prop and or injury to personnel | | 1.00E-04 | L |
| | 7.1.2.2 Transportation by manual labour | | 6.03E-03 | |
| | 7.1.2.2.1 Slip and fall OR | | 3.00E-04 | |
| | 7.1.2.2.1.1 Loose rock on footwall OR | | 1.00E-04 | L |
| | 7.1.2.2.1.2 Steep dipping stope angle OR | | 1.00E-04 | L |
| | 7.1.2.2.1.3 Smooth slippery footwall | | 1.00E-04 | L |
| | 7.1.2.2.2 Poor carrying method OR | | 1.00E-05 | VL |
| | 7.1.2.2.3 Poor human ability OR | | 2.20E-03 | |
| | 7.1.2.2.3.1 Long Distance OR | | 1.00E-03 | M |
| | 7.1.2.2.3.2 Excessive weight OR | | 1.20E-03 | |
| | 7.1.2.2.3.2.1 Back strain OR | | 1.00E-04 | L |
| | 7.1.2.2.3.2.2 Difficulty with long props OR | | 1.00E-03 | M |
| | 7.1.2.2.3.2.3 Slip and fall | | 1.00E-04 | L |
| | 7.1.2.2.4 Dropping of props OR | | 1.00E-04 | L |
| | 7.1.2.2.5 Injury caused by moving parts OR | | 1.00E-04 | L |
| | 7.1.2.2.6 Damage to props while being transported OR | | 1.00E-04 | L |
| | 7.1.2.2.7 Difficulty of transporting in confined spaces OR | | 1.00E-03 | M |
| | 7.1.2.2.8 Extreme heat OR | | 1.10E-05 | |

| | | | | |
|--------------|---|--|----------|----|
| | 7.1.2.2.9.1 Heat stroke OR | | 1.00E-06 | EL |
| | 7.1.2.2.9.2 Heat exhaustion | | 1.00E-05 | VL |
| | 7.1.2.2.9 Fall of ground caused by disturbance of the hangingwall OR | | 1.00E-04 | L |
| | 7.1.2.2.10 Injury caused by obstructions OR | | 2.02E-03 | |
| | 7.1.2.2.10. Protruding roof bolts OR | | 1.00E-05 | VL |
| | 7.1.2.2.10. Other material being Transported OR | | 1.00E-05 | VL |
| | 7.1.2.2.10. Other material lying in the path OR | | 1.00E-03 | M |
| | 7.1.2.2.10. Poor footwall conditions | | 1.00E-03 | M |
| | 7.1.2.2.11 Insufficient labour | | 1.00E-04 | L |
| 7.1.3 | Transport to development | | 5.63E-03 | |
| 7.1.3.1 | Inclined development | | 3.92E-03 | |
| 7.1.3.1.1 | Slip and fall OR | | 2.00E-04 | |
| | 7.1.3.1.1.1 Loose rock on footwall OR | | 1.00E-04 | L |
| | 7.1.3.1.1.2 Smooth slippery footwall | | 1.00E-04 | L |
| | 7.1.3.1.2 Poor carrying method OR | | 1.00E-05 | VL |
| | 7.1.3.1.3 Poor human ability OR | | 2.20E-03 | |
| | 7.1.3.1.3.1 Long Distance OR | | 1.00E-03 | M |
| | 7.1.3.1.3.2 Excessive weight | | 1.20E-03 | |
| | 7.1.3.1.3.2.1 Back strain OR | | 1.00E-04 | L |
| | 7.1.3.1.3.2.2 Difficulty with long props OR | | 1.00E-03 | M |
| | 7.1.1.2.4.2.3 Slip and fall | | 1.00E-04 | L |
| | 7.1.3.1.4 Dropping of props OR | | 1.00E-04 | L |
| | 7.1.3.1.5 Injury caused by moving parts OR | | 1.00E-04 | L |
| | 7.1.3.1.6 Damage to props while being transported OR | | 1.00E-06 | EL |
| | 7.1.3.1.7 Difficulty of transporting in confined spaces OR | | 1.00E-06 | EL |
| | 7.1.3.1.8 Extreme heat OR | | 1.10E-06 | |
| | 7.1.3.1.8.1 Heat stroke OR | | 1.00E-07 | PZ |
| | 7.1.3.1.8.2 Heat exhaustion | | 1.00E-06 | EL |
| | 7.1.3.1.9 Fall of ground caused by disturbance of the hangingwall or sidewall OR | | 1.00E-05 | VL |
| | 7.1.3.1.10 Injury caused by obstructions | | 1.20E-03 | |
| | 7.1.3.1.10. Protruding roof bolts OR | | 1.00E-06 | EL |
| | 7.1.3.1.10. Other material being Transported OR | | 1.00E-04 | L |
| | 7.1.3.1.10. Other material lying in the path OR | | 1.00E-03 | M |
| | 7.1.3.1.10. Poor footwall conditions OR | | 1.00E-04 | L |
| | 7.1.3.1.11 Insufficient Labour | | 1.00E-04 | L |
| 7.1.3.2 | Horizontal development | | 1.72E-03 | |
| 7.1.3.2.1 | Slip and fall OR | | 1.00E-04 | |
| | 7.1.3.2.1.1 Loose rock on footwall OR | | 1.00E-04 | L |
| | 7.1.3.2.1.2 Smooth slippery footwall | | 1.00E-07 | PZ |
| | 7.1.3.2.2 Poor carrying method OR | | 1.00E-05 | VL |
| | 7.1.3.2.3 Poor human ability OR | | 1.30E-03 | |
| | 7.1.3.2.3.1 Long Distance OR | | 1.00E-04 | L |
| | 7.1.3.2.3.2 Excessive weight OR | | 1.20E-03 | |
| | 7.1.3.2.3.2.1 Back strain OR | | 1.00E-04 | L |
| | 7.1.3.2.3.2.2 Difficulty with long props OR | | 1.00E-03 | M |
| | 7.1.3.2.3.2.3 Slip and fall | | 1.00E-04 | L |
| | 7.1.3.2.4 Dropping of props OR | | 1.00E-04 | L |
| | 7.1.3.2.5 Injury caused by moving parts OR | | 1.00E-04 | L |
| | 7.1.3.2.6 Damage to props while being transported OR | | 1.00E-06 | EL |
| | 7.1.3.2.7 Difficulty of transporting in confined spaces OR | | 1.00E-06 | EL |
| | 7.1.3.2.8 Extreme heat OR | | 1.10E-06 | |
| | 7.1.3.2.8.1 Heat stroke OR | | 1.00E-07 | PZ |
| | 7.1.3.2.8.2 Heat exhaustion | | 1.00E-06 | EL |
| | 7.1.3.2.9 Fall of ground caused by disturbance of the hangingwall or sidewall OR | | 1.00E-06 | EL |
| | 7.1.3.2.10 Injury caused by obstructions | | 1.03E-04 | |
| | 7.1.3.2.10. Protruding roof bolts OR | | 1.00E-06 | EL |

| | | | |
|--|----------|----|--|
| 7.1.3.2.10. Other material being Transported OR | 1.00E-06 | EL | |
| 7.1.3.2.10. Other material lying in the path OR | 1.00E-06 | EL | |
| 7.1.3.2.10. Poor footwall conditions OR | 1.00E-04 | L | |
| 7.1.3.2.11 Insufficient Labour | 1.00E-07 | PZ | |

8. Installation

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 50.00% |
| Exposure results in fatal accidents (%) | 5 |
| Exposure results in injuries only (%) | 95 |
| Risk of fatal accident (number of fatal accidents) | 4.89E-03 |
| Risk of injury (number of people injured) | 9.29E-02 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - Rev 2006 |

| FAULT TREE ANALYSIS | | | |
|---|---------------------------|--------------------|---------------------------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | Probability of Occurrence | Comments / Remarks | |
| | | | |
| 8 Threat of injury to mine personnel through the use of Medium Duty Camloks while installing a prop | 1.95E-01 | | |
| 8.1 Poor making safe OR | 3.58E-04 | | |
| 8.1.1 Fall of ground AND | 1.10E-02 | | |
| 8.1.1.1 Fall of ground due to disturbance of the hangingwall OR | 1.10E-02 | | |
| 8.1.1.1.1 Prop disturbing the hangingwall OR | 1.00E-03 | M | |
| 8.1.1.1.4 Insufficient preload | 1.00E-02 | H | |
| 8.1.2 Poor Ground Conditions | 3.26E-02 | | |
| 8.1.1.1 Highly Jointed OR | 1.00E-02 | H | |
| 8.1.1.2 Faulting OR | 1.00E-03 | M | |
| 8.1.1.3 Dykes OR | 1.00E-03 | M | |
| 8.1.1.4 Poor Blasting OR | 1.00E-02 | H | |
| 8.1.1.5 Flat dipping joints / fractures OR | 1.00E-02 | H | |
| 8.1.1.6 Weak rock mass strength | 1.00E-03 | M | |
| 8.2 Poor footwall conditions OR | 1.99E-02 | | |
| 8.2.1 Footwall not cleaned properly | 1.99E-02 | | |
| 8.2.1.1 Slip and fall OR | 1.00E-02 | H | |
| 8.2.1.2 Unstable footing of prop | 1.00E-02 | H | |
| 8.3 Poor permanent support installation OR | 1.00E-02 | H | Permanent support is to mine standard |
| 8.4 Failure to examine prop condition OR | 1.99E-02 | | |
| 8.4.1 Prop fails to perform to specifications OR | 1.00E-02 | H | |
| 8.4.2 Failure to install prop | 1.00E-02 | H | |
| 8.5 Poor positioning of prop OR | 8.87E-02 | | |
| 8.5.1 Spacing not to mine standards OR | 2.97E-02 | | |
| 8.5.1.1 Insufficient props OR | 1.00E-02 | H | |
| 8.5.1.2 Poor knowledge of mine standard OR | 1.00E-02 | H | |
| 8.5.1.3 Incorrect length of prop / excessive stoping width | 1.00E-02 | H | |
| 8.5.2 Slipping and Falling OR | 1.99E-02 | | |
| 8.5.2.1 Loose rock on footwall OR | 1.00E-02 | H | |
| 8.5.2.2 Smooth slippery footwall | 1.00E-02 | H | |
| 8.5.3 Poor Handling of prop OR | 1.10E-03 | | |
| 8.5.3.1 Injured by being struck by the sliding outer tube OR | 1.00E-03 | M | |
| 8.5.3.2 Injured by being struck by an unlocked handle | 1.00E-04 | L | |
| 8.5.4 Incorrect position of person installing prop OR | 1.99E-02 | | |
| 8.5.4.1 installing a prop from an unsupported area OR | 1.00E-02 | H | |
| 8.5.4.2 Incorrect body position | 1.00E-02 | H | |
| 8.5.4.2.1 Back strain | 1.00E-02 | H | |
| 8.5.5 Incorrect orientation of prop OR | 1.01E-02 | | |
| 8.5.5.1 Unable to remote release OR | 1.00E-02 | H | |

| | | | | |
|--------------|---|-----------------|----|--|
| 8.5.5.2 | Headboard not orientated in appropriate direction | 1.00E-04 | L | |
| 8.5.6 | Lack of PPE OR | 2.00E-04 | | |
| 8.5.6.1 | No Gloves OR | 1.00E-04 | L | |
| 8.5.6.2 | No eye protection | 1.00E-04 | L | |
| 8.5.7 | Steep dipping excavations | 1.10E-02 | | |
| 8.5.7.1 | Injury due to falling prop OR | 1.00E-03 | M | |
| 8.5.7.2 | Poor installation angle | 1.00E-02 | H | |
| 8.6 | Failure to extend outer tube and locate setting pin correctly OR | 5.20E-02 | | |
| 8.6.1 | Headboard too close to hangingwall OR | 1.30E-02 | | |
| 8.6.1.1 | Insufficient lift of cam OR | 1.00E-03 | M | |
| 8.6.1.2 | Slipping back of the cam during loading due to insufficient cam rotation OR | 1.00E-02 | H | |
| 8.6.1.3 | Failure to zero the cams OR | 1.00E-03 | M | |
| 8.6.1.4 | Incorrect length of prop / excessive stoping width | 1.00E-03 | M | |
| 8.6.2 | Setting pin not fully inserted OR | 1.99E-02 | | |
| 8.6.2.1 | Poor performance of prop OR | 1.00E-02 | H | |
| 8.6.2.2 | Prop may become dislodged OR | 1.00E-07 | PZ | |
| 8.6.2.3 | Poor preload placed on prop OR | 1.00E-07 | PZ | |
| 8.6.2.4 | Incorrect orientation of setting pin for remote release | 1.00E-02 | H | |
| 8.6.3 | Hand injury during pin insertion OR | 1.00E-08 | | |
| 8.6.3.1 | Lack of grip leading to hand and finger injuries AND | 1.00E-05 | VL | |
| 8.6.3.2 | No gloves | 1.00E-03 | M | |
| 8.6.4 | High Excavations > 2.5 metres OR | 1.99E-02 | | |
| 8.6.4.1 | Injury caused by falling prop OR | 1.00E-02 | H | |
| 8.6.4.2 | Incorrect headboard orientation | 1.00E-02 | H | |
| 8.6.5 | Slipping of outer tube OR | 1.00E-08 | | |
| 8.6.5.1 | Injury caused by slipping outer tube AND | 1.00E-05 | VL | |
| 8.6.5.2 | No Gloves | 1.00E-03 | M | |
| 8.6.6 | Incorrect orientation of headboard | 1.00E-04 | | |
| 8.6.5.1 | Headboard fails to contain face parallel fracturing | 1.00E-04 | L | |
| 8.7 | Failure to pre tension the cams correctly | 2.05E-02 | | |
| 8.7.1 | Headboard too close to hangingwall OR | 1.00E-04 | | |
| 8.7.1.1 | Insufficient preload AND | 1.00E-02 | H | |
| 8.7.1.2 | Dislodged prop | 1.00E-02 | H | |
| 8.7.2 | Headboard too far from hangingwall OR | 1.00E-04 | | |
| 8.7.1.1 | Insufficient preload AND | 1.00E-02 | H | |
| 8.7.1.2 | Dislodged prop | 1.00E-02 | H | |
| 8.7.3 | Failure to disengage jacking handle on return OR | 1.00E-04 | | |
| 8.7.3.1 | Unable to install prop | 1.00E-04 | L | |
| 8.7.4 | Corrosion of cam mechanism OR | 1.00E-04 | | |
| 8.7.4.1 | Insufficient preload AND | 1.00E-02 | H | |
| 8.7.4.2 | Dislodged prop | 1.00E-02 | H | |
| 8.7.5 | Failure to lock jacking handle after preloading OR | 1.99E-02 | | |
| 8.7.5.1 | Trip and fall OR | 1.00E-02 | H | |
| 8.7.5.2 | Dislodged prop | 1.00E-02 | H | |
| 8.7.6 | Lack of human ability | 1.99E-04 | | |
| 8.7.6.1 | Back strain OR | 1.00E-04 | L | |
| 8.7.6.2 | Hand injury OR | 1.00E-04 | L | |
| 8.7.6.3 | Insufficient preload | 1.00E-02 | H | |

9. Installed Prop

EVENT TREE ANALYSIS

| | |
|---|-----------------|
| Average time of exposure (%) | 100.00% |
| Exposure results in fatal accidents (%) | 5 |
| Exposure results in injuries only (%) | 95 |
| Risk of fatal accident (number of fatal accidents) | 6.90E-03 |
| Risk of injury (number of people injured) | 1.31E-01 |

Client Name:

M Props (Pty) Ltd

Date of risk assessment:

May 2006

Product:

Medium Duty Camlok Prop - Rev 2006

FAULT TREE ANALYSIS

| | | Probability of Occurrence | | Comments / Remarks |
|---|---|---------------------------|---|--------------------|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | 1.38E-01 | | |
| 9 | Threat of injury to mine personnel through the use of Medium Duty Camloks during shift | 1.38E-01 | | |
| 9.1 | Unapproved use of prop other than support OR | 1.00E-02 | | |
| 9.1.1 | Dislodging of prop | 1.00E-02 | H | |
| 9.2 | Fall of Ground OR | 4.42E-02 | | |
| 9.2.1 | Dislodging of prop OR | 1.20E-02 | | |
| 9.2.1.1 | Lateral loading on prop by fall of ground up dip OR | 1.00E-03 | M | |
| 9.2.1.2 | Block rotation and prop sliding out OR | 1.00E-02 | H | |
| 9.2.1.3 | Structural failure of prop due to excessive loading | 1.00E-03 | M | |
| 9.2.2 | Poor Ground Conditions | 3.26E-02 | | |
| 9.2.2.1 | Highly Jointed OR | 1.00E-02 | H | |
| 9.2.2.2 | Faulting OR | 1.00E-03 | M | |
| 9.2.2.3 | Dykes OR | 1.00E-03 | M | |
| 9.2.2.4 | Poor Blasting OR | 1.00E-02 | H | |
| 9.2.2.5 | Flat dipping joints / fractures OR | 1.00E-02 | H | |
| 9.2.2.6 | Weak rock mass strength | 1.00E-03 | M | |
| 9.3 | Inappropriate support design OR | 2.98E-02 | | |
| 9.3.1 | Inappropriate prop type for loading conditions | 2.98E-02 | | |
| 9.3.1.1 | Incorrect prop performance | 2.98E-02 | | |
| 9.3.1.1.1 | Lack of yielding OR | 1.00E-02 | H | |
| 9.3.1.1.2 | Insufficient load bearing capability OR | 1.00E-04 | L | |
| 9.3.1.1.3 | Insufficient areal coverage capability OR | 1.00E-02 | H | |
| 9.3.1.1.4 | Prop dislodged due to lateral loading by safety nets exceeding prop capability | 1.00E-02 | H | |
| 9.4 | Illegal prop removal OR | 6.10E-02 | | |
| 9.4.1 | Fall of ground AND | 9.90E-01 | | |
| 9.4.1.1 | Increased support spacing OR | 1.00E-02 | H | |
| 9.4.1.2 | Reducing of support resistance | 1.00E-02 | H | |
| 9.4.2 | Poor Ground Conditions OR | 3.26E-02 | | |
| 9.4.2.1 | Highly Jointed OR | 1.00E-02 | H | |
| 9.4.2.2 | Faulting OR | 1.00E-03 | M | |
| 9.4.2.3 | Dykes OR | 1.00E-03 | M | |
| 9.4.2.4 | Poor Blasting OR | 1.00E-02 | H | |
| 9.4.2.5 | Flat dipping joints / fractures OR | 1.00E-02 | H | |
| 9.4.2.6 | Weak rock mass strength | 1.00E-03 | M | |
| 9.4.3 | Obstruction | 2.97E-02 | | |
| 9.4.3.1 | Using prop as a strut by drill operator OR | 1.99E-02 | | |
| 9.4.3.1.1 | Fall of ground due to vibration OR | 1.00E-02 | H | |
| 9.4.3.1.2 | Struck by falling prop | 1.00E-02 | H | |
| 9.4.3.2 | Tripping over jacking handles | 1.00E-02 | H | |

10. Prop Removal

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 25.00% |
| Exposure results in fatal accidents (%) | 5 |
| Exposure results in injuries only (%) | 95 |
| Risk of fatal accident (number of fatal accidents) | 2.63E-04 |
| Risk of injury (number of people injured) | 4.99E-03 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

| FAULT TREE ANALYSIS | | | | |
|---|--|---------------------------|----|---------------------------------|
| | | Probability of Occurrence | | Comments / Remarks |
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | 2.10E-02 | | |
| 10 | Threat of injury to mine personnel through the use of Medium Duty Camlok while removing after the shift | 2.10E-02 | | |
| 10.1 | Rockfall on person OR | 7.84E-03 | | |
| 10.1.1 | Person in wrong position AND | 2.41E-01 | | |
| 10.1.1.1 | Incorrect length sling OR | 1.00E-02 | H | |
| 10.1.1.2 | No Sling available OR | 1.00E-01 | VH | |
| 10.1.1.3 | Lack of training OR | 1.00E-02 | H | |
| 10.1.1.4 | Prop orientated incorrectly for remote release OR | 1.00E-02 | H | |
| 10.1.1.5 | Releasing prop from an unsupported area OR | 1.00E-02 | H | |
| 10.1.1.6 | Prop obstructed OR | 1.00E-03 | M | |
| 10.1.1.7 | Insufficient cam rotation OR | 1.00E-02 | H | |
| 10.1.1.8 | Failure of prop to release resulting in unauthorised removal method OR | 1.00E-01 | VH | Area cordoned off and made safe |
| 10.1.1.9 | Person in down dip position struck by falling rocks OR | 1.00E-02 | H | |
| 10.1.1.9 | Breakages to components | 3.10E-03 | | |
| 10.1.1.9.1 | Sling breaks OR | 1.00E-04 | L | |
| 10.1.1.9.2 | Ferrule slips OR | 1.00E-03 | M | |
| 10.1.1.9.3 | Pig tail damaged OR | 1.00E-03 | M | |
| 10.1.1.9.4 | Damage caused by general wear and tear | 1.00E-03 | M | |
| 10.1.2 | Poor Ground Conditions | 3.26E-02 | | |
| 10.1.2.1 | Highly Jointed OR | 1.00E-02 | H | |
| 10.1.2.2 | Faulting OR | 1.00E-03 | M | |
| 10.1.2.3 | Dykes OR | 1.00E-03 | M | |
| 10.1.2.4 | Poor Blasting OR | 1.00E-02 | H | |
| 10.1.2.5 | Flat dipping joints / fractures OR | 1.00E-02 | H | |
| 10.1.2.6 | Weak rock mass strength | 1.00E-03 | M | |
| 10.2 | Prop falling on person OR | 1.10E-02 | | |
| 10.2.1 | Struck by falling prop | 1.10E-02 | | |
| 10.2.1.1 | Sling too short for prop length causing prop to strike personnel OR | 1.00E-02 | H | |
| 10.2.1.2 | Release of props from down dip position | 1.00E-03 | M | |
| 10.3 | Injury of person due to strain | 2.30E-03 | | |
| 10.3.1 | Excessive heat conditions OR | 1.01E-04 | | |
| 10.3.1.1 | Heat stroke OR | 1.00E-06 | EL | |
| 10.3.1.2 | Heat exhaustion | 1.00E-04 | L | |
| 10.3.2 | Injury while releasing prop | 2.20E-03 | | |
| 10.3.2.1 | Back strain due to incorrect body position OR | 1.00E-04 | L | |
| 10.3.2.2 | Hand injury due to wrapping sling around hand before releasing prop OR | 1.00E-03 | M | |
| 10.3.2.3 | Injury caused by slip and fall OR | 1.00E-03 | M | |
| 10.3.2.4 | Sling breaks causing person to fall | 1.00E-04 | L | |

11. Underground Storage

| EVENT TREE ANALYSIS | |
|---|-----------------|
| Average time of exposure (%) | 12.50% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 1.02E-06 |
| Risk of injury (number of people injured) | 1.02E-03 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

| FAULT TREE ANALYSIS | | | | |
|---|--|--|---------------------------|--------------------|
| | | | Probability of Occurrence | Comments / Remarks |
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | | | 8.17E-03 | |
| 11 | Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor underground storage of props | | 8.17E-03 | |
| | 11.1 | Damage to props and accessories | 8.17E-03 | |
| | 11.1.1 | Failure of props and accessories | 8.17E-03 | |
| | 11.1.1.1 | Blast Damage to props OR | 1.00E-03 | M |
| | 11.1.1.2 | Corrosion of props OR | 2.00E-03 | |
| | | 11.1.1.2.1 Cam mechanism is defective due to mud accumulation OR | 1.00E-03 | M |
| | | 11.1.1.2.2 Cam mechanism is defective due to corrosion | 1.00E-03 | M |
| | 11.1.1.3 | Poor storage OR | 1.20E-03 | |
| | | 11.1.1.3.1 Injury due to falling props OR | 1.00E-04 | L |
| | | 11.1.1.3.2 Trip and fall OR | 1.00E-03 | M |
| | | 11.1.1.3.3 Poor handling of long props | 1.00E-04 | L |
| | 11.1.1.4 | Damage by Scraper OR | 1.00E-03 | |
| | | 11.1.1.4.1 Prop Damaged | 1.00E-03 | M |
| | 11.1.1.5 | Poor Sling Storage OR | 1.00E-03 | |
| | | 11.1.1.5.1 Sling Failure | 1.00E-03 | M |
| | 11.1.1.6 | Loss of material | 2.00E-03 | |
| | | 11.1.1.6.1 Inability to support to mine standard OR | 1.00E-03 | M |
| | | 11.1.1.6.2 Lost blast | 1.00E-03 | M |

12. Daily Underground Prop Assessment

| EVENT TREE ANALYSIS | |
|--|----------|
| Average time of exposure (%) | 12.50% |
| Exposure results in fatal accidents (%) | 0.1 |
| Exposure results in injuries only (%) | 99.9 |
| Risk of fatal accident (number of fatal accidents) | 2.35E-06 |
| Risk of injury (number of people injured) | 2.35E-03 |

| | |
|--------------------------|------------------------------------|
| Client Name: | M Props (Pty) Ltd |
| Date of risk assessment: | May 2006 |
| Product: | Medium Duty Camlok Prop - rev 2006 |

| FAULT TREE ANALYSIS | | | |
|--|---------------------------|---|--|
| Threat of injury to mine personnel through the use of Medium Duty Camlok props occurring | Probability of Occurrence | | Comments / Remarks |
| | | | |
| 12 Threat of injury to mine personnel through the use of Medium Duty Camloks due to poor prop performance due to poor daily underground assessment | 1.88E-02 | | |
| 12.1 Poor prop assessment OR | 1.29E-02 | | |
| 12.1.1 Failure to identify | 1.29E-02 | | |
| 12.1.1.1 Damaged headboard OR | 1.00E-03 | M | |
| 12.1.1.2 Damaged / bent outer tube OR | 1.00E-03 | M | |
| 12.1.1.3 Damaged setting holes OR | 1.00E-03 | M | |
| 12.1.1.4 Damaged pin and chain OR | 1.00E-03 | M | |
| 12.1.1.5 Damaged inner tube OR | 1.00E-03 | M | |
| 12.1.1.6 Damaged handle securing cable OR | 1.00E-03 | M | |
| 12.1.1.7 Damaged releasing hook OR | 1.00E-03 | M | |
| 12.1.1.8 Damaged / bent handle OR | 1.00E-03 | M | |
| 12.1.1.9 Damaged / bent handle U strap OR | 1.00E-03 | M | |
| 12.1.1.10 Damaged locating lug OR | 1.00E-03 | M | |
| 12.1.1.11 Missing corrosion washer OR | 1.00E-03 | M | Indicates maximum corrosion allowable. |
| 12.1.1.12 Excessive wear / damage to cam mechanism including gear OR | 1.00E-03 | M | |
| 12.1.1.13 Damaged / missing foot piece | 1.00E-03 | M | |
| 12.2 Poor Sling Assessment | 5.99E-03 | | |
| 12.2.1 Failure to identify | 5.99E-03 | | |
| 12.2.1.1 Incorrect sling length OR | 1.00E-03 | M | |
| 12.2.1.2 Damaged plastic cover OR | 1.00E-03 | M | |
| 12.2.1.3 Broken / kinked cable strands OR | 1.00E-03 | M | |
| 12.2.1.4 Damaged / missing handle OR | 1.00E-03 | M | |
| 12.2.1.5 Damaged / missing loop OR | 1.00E-03 | M | |
| 12.2.1.6 Damaged / missing pig tail | 1.00E-03 | M | |

Steffen, Robertson and Kirsten (South Africa) (Pty) Ltd

Report Distribution Record

Report No. :

334822/2

Copy No. :

| Name/Title | Company | Copy | Date | Authorised By |
|-------------------|-------------------|------|------|---------------|
| Colin May | M Props (Pty) Ltd | 1-3 | | |
| Departmental Copy | SRK Consulting | 4 | | |
| SRK Library | SRK Consulting | 5 | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |

Approval Signature :

Copyright

This technical report (a) enjoys copyright protection and the copyright vests in Steffen, Robertson and Kirsten (South Africa) (Pty) Ltd unless otherwise agreed to in writing; (b) may not be reproduced or transmitted in any form or by any means whatsoever to any person without the written permission of the copyright holder.

ACKNOWLEDGEMENT OF RECEIPT
MEDIUM DUTY CAMLOK PROP RISK ASSESSMENT – REVISION 2006

This document was provided to

_____ (Print Client Name)

as a copy of the original risk assessment developed by **SRK Consulting** and I

declare that no changes or alterations have been made to this document.

On behalf of M PROPS

_____ (Signature)

This document was delivered to

_____ (Print Name)

and accepted as a copy of the original document developed by **SRK Consulting** as declared by the supplier.

On behalf of Client

_____ (Signature)